

## MODEL FS-3

# Volt-Amp-Ohm-Temperature Flat Scale Clamp-on

### FEATURES

- Drop proof up to 5 feet.
- Ohmmeter fused to 250VAC.
- Check surface, air or liquid temperatures.
- Taut band meter movement.
- Average sensing, RMS calibrated.
- Pointer lock.

### SPECIFICATIONS


**Ranges:** 0-6/15/40/100/300 Amps AC  
0-150/300/600 Volts AC  
Rx1 and Rx100 Ohms (25 midscale on Rx1)  
-25°F to 225°F (-32°C to +107°C)

**Frequency:** 50/60 Hz

**Accuracy:** ±3% F.S. (Amps, Volts)  
±3% of scale length (Ohms, Temperature)

**Power:** One S915 "AA" battery (not supplied)

**Fuse:** One 8AG-361.5, 0.5 Amp,  
250 Volts Fast Blow (supplied)

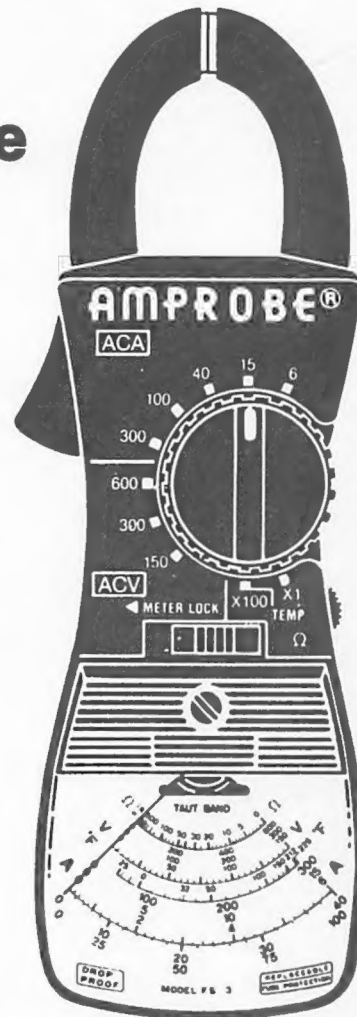

#### Model FS-3:

Fahrenheit scale instrument with leads.

#### Model FS-3C:

Centigrade scale instrument with leads.

#### Model FS-3L:

Fahrenheit scale instrument with leads and case.

#### Model FS-3CL:

Centigrade scale instrument with leads and case.

### ACCESSORIES AND REPLACEMENTS

Description	Model
Fuse, .5 Amps, 250 Volts, Fast Blow	8AG-361.5
Battery, AA (requires 1)	S915
Immersion Temperature Probe	RBT-11P
Universal Temperature Probe	RBT-12P
Vented Air Temperature Probe	RBT-13P
Clip-type Test Leads	VL-11R
Carrying Case	L